

Oyster Bay – East Norwich Union Free School District

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project # 20895

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Oyster Bay – East Norwich Union Free School District
1 McCouns Lane
Oyster Bay, NY 11771

May 2021

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project # 20895

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

- I. Executive Summary
- II. Sampling Methodology
- III. Initial Results

Appendix A – James Vernon Elementary School

Appendix B – Theodore Roosevelt Elementary School

Appendix C – Oyster Bay-East Norwich High School

June 3, 2021

Michael Cipriani
Oyster Bay-East Norwich UFSD
1 McCouns Lane
Oyster Bay, NY 11771

I. Executive Summary

The Oyster Bay-East Norwich UFSD has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Oyster Bay-East Norwich UFSD, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Home Economics and Culinary Arts classroom sinks
- 5) Elementary classroom sinks
- 6) Bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Oyster Bay-East Norwich UFSD were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Oyster Bay-East Norwich UFSD on May 25 & 26, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

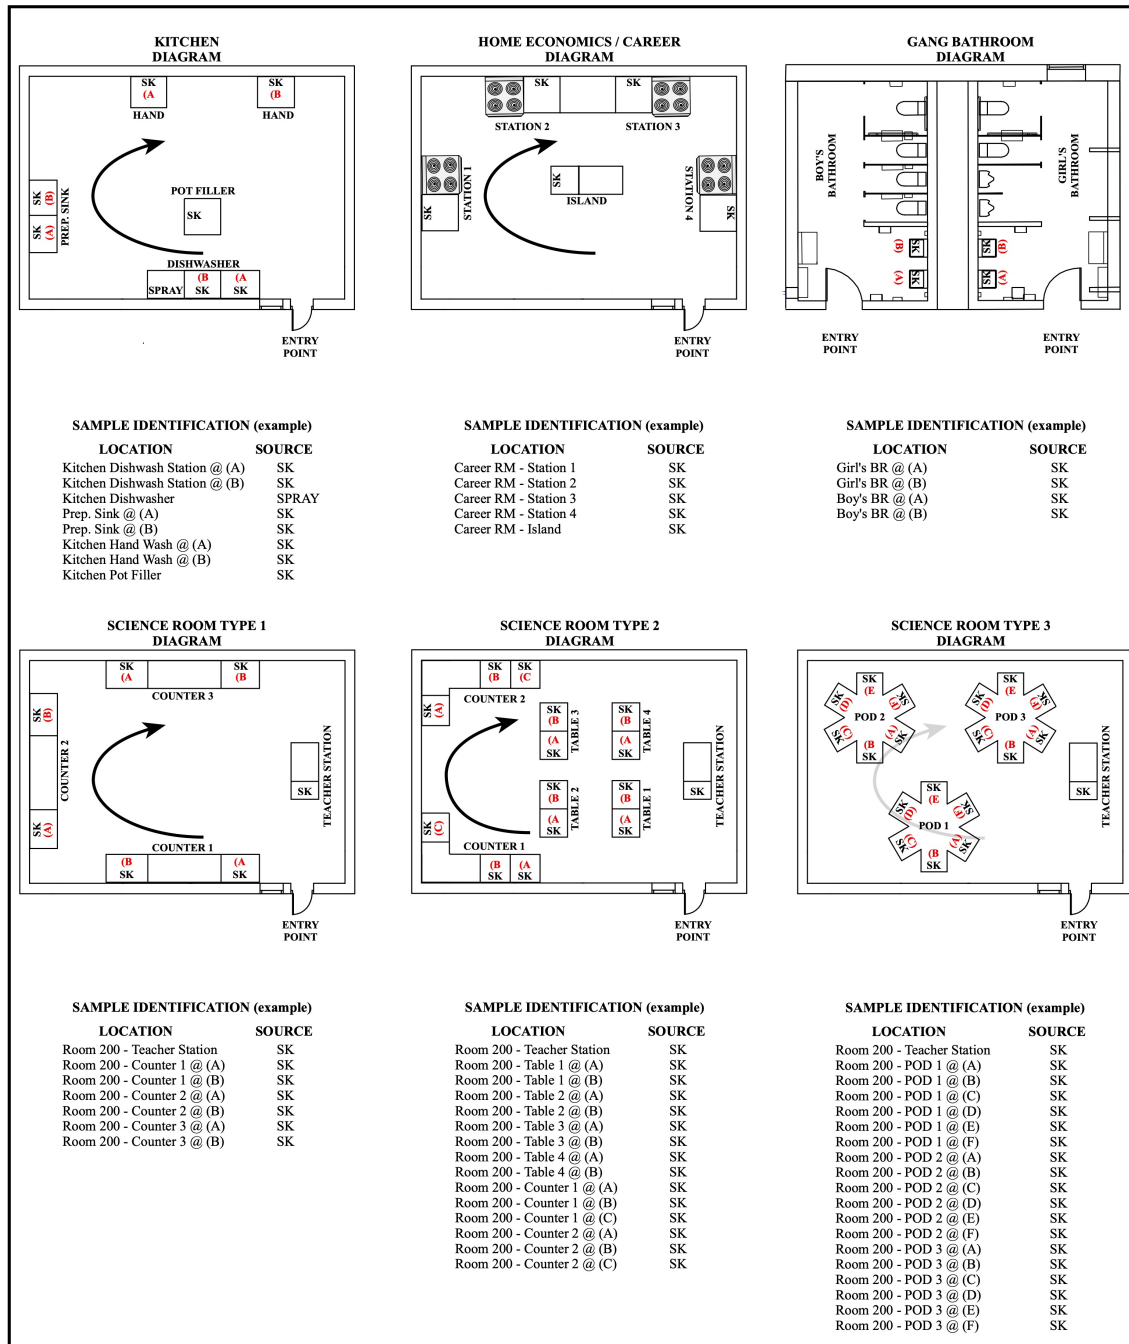

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

James Vernon Elementary School

Room 32 / 31 Prep Room	SK	66.9
Science Room 22 Counter	SK	25

Theodore Roosevelt Elementary School

Kitchen pot filler	PF	282
Kitchen sink by ice machine	SK	38.4
Music Room	SK	18.9
Room 10 - right	SK	15.5

Oyster Bay-East Norwich High School

Hall by Room 116	WF	25.3
Hall by Room 216	WF	22.3
Science Room 217 / 219 Prep Room	SK	44.6
Boy's Bathroom 213A - left	SK	16.5

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-01	Boiler Room	SS	N/A		5/26/2021	-	-	-	Sign Required	-	-	-
1002-01	Kitchen 3-Bay Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1002-02	Kitchen 3-Bay Right	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1002-03	Kitchen Handwash	SK	N/A		5/26/2021	-	-	-	Sign Required	-	-	-
1003-01	Cafeteria	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1004-01	Nurse's Office	SK	App	3.98	5/26/2021	-	-	-	None	-	-	-
1004-02	Nurse's Office Bathroom	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-01	Faculty Bathroom 50 by Principal's Office	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1006-01	Faculty Bathroom 48 by Principal's Office	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1007-01	Boy's Bathroom 41 by Library Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1007-02	Boy's Bathroom 41 by Library Left Middle	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1007-03	Boy's Bathroom 41 by Library Right Middle	SK	App	1.27	5/26/2021	-	-	-	None	-	-	-
1007-04	Boy's Bathroom 41 by Library Right	SK	App	1.02	5/26/2021	-	-	-	None	-	-	-
1008-01	Hall by Library	WF	App	<1.0	5/26/2021	-	-	-	None	Removed from service	-	-
1008-02	Hall by Library	BF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1009-01	Custodial Closet 42 by Library	SS	N/A		5/26/2021	-	-	-	None	Locked Door	-	-
1010-01	Girl's Bathroom 43 by Library Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1010-02	Girl's Bathroom 43 by Library Middle	SK	App	1.12	5/26/2021	-	-	-	None	-	-	-
1010-03	Girl's Bathroom 43 by Library Right	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1011-01	Room 6	SK	App	3.34	5/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-02	Room 6	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1012-01	Room 5	SK	App	5.17	5/26/2021	-	-	-	None	-	-	-
1012-02	Room 5	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1013-01	Room 4	SK	App	11	5/26/2021	-	-	-	None	-	-	-
1013-02	Room 4	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1014-01	Room 3	SK	App	5.1	5/26/2021	-	-	-	None	-	-	-
1014-02	Room 3	WF	App	1.02	5/26/2021	-	-	-	None	-	-	-
1015-01	Room 2	SK	App	5.31	5/26/2021	-	-	-	None	-	-	-
1015-02	Room 2	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1016-01	Room 1	SK	App	2.34	5/26/2021	-	-	-	None	-	-	-
1016-02	Room 1	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1017-01	Head Custodian's Office 38	SK	App	3.91	5/26/2021	-	-	-	None	-	-	-
1018-01	Coach's Office 37	SK	App	2.27	5/26/2021	-	-	-	None	-	-	-
1019-01	Boy's Locker Room Bathroom 36	SK	App	1.28	5/26/2021	-	-	-	None	-	-	-
1020-01	Hall by Boy's Locker Room 36	WF	App	4.58	5/26/2021	-	-	-	None	-	-	-
1021-01	Girl's Locker Room Bathroom 35	SK	App	3.36	5/26/2021	-	-	-	None	-	-	-
1022-01	Faculty Room 72	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1023-01	Boy's Bathroom 62 by Room 63 Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1023-02	Boy's Bathroom 62 by Room 63 Middle	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1023-03	Boy's Bathroom 62 by Room 63 Right	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-01	Custodial Closet 61 by Room 63	SS	N/A		5/26/2021	-	-	-	None	Locked Door	-	-
1025-01	Girl's Bathroom 60 by Room 63 Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1025-02	Girl's Bathroom 60 by Room 63 Middle	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1025-03	Girl's Bathroom 60 by Room 63 Right	SK	App	1.11	5/26/2021	-	-	-	None	-	-	-
1026-01	Hall by Room 63 Left	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1026-02	Hall by Room 63 Middle	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1026-03	Hall by Room 63 Middle	BF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1026-04	Hall by Room 63 Right	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1027-01	Faculty Bathroom 70 by Room 68B	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1028-01	Faculty Bathroom 71 by Room 68B	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1029-01	Room 33A	SK	App	8.25	5/26/2021	-	-	-	None	-	-	-
1030-01	Room 32	SK	App	4.96	5/26/2021	-	-	-	None	-	-	-
1030-02	Room 32 / 31 Prep Room	SK	App	66.9	5/26/2021				Additional Sampling Required			
1031-01	Room 31 Left	SK	App	4.88	5/26/2021	-	-	-	None	-	-	-
1031-02	Room 31 Middle	SK	App	4.28	5/26/2021	-	-	-	None	-	-	-
1031-03	Room 31 Right	SK	App	6.8	5/26/2021	-	-	-	None	-	-	-
1032-01	Room 30	SK	App	7.79	5/26/2021	-	-	-	None	-	-	-
1033-01	Faculty Bathroom 30B by Room 26	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1034-01	Faculty Bathroom 30A by Room 26	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1035-01	Hall by Room 27 Portable	SK	App	2.4	5/26/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1036-01	Room 11	SK	App	3.3	5/26/2021	-	-	-	None	-	-	-
1037-01	Room 13	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1038-01	Boy's Bathroom by Room 13 Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1038-02	Boy's Bathroom by Room 13 Right	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1039-01	Custodial Closet by Room 13	SS	N/A		5/26/2021	-	-	-	None	Locked Door	-	-
1040-01	Hall by Room 13	WF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1040-02	Hall by Room 13	BF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1041-01	Girl's Bathroom by Room 13 Left	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1041-02	Girl's Bathroom by Room 13 Right	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1042-01	Room 15	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1043-01	Room 14	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1044-01	Room 17	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1045-01	Room 16	SK	App	3.76	5/26/2021	-	-	-	None	-	-	-
1045-02	Room 16	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1046-01	Room 20 BR	SK	App	4.48	5/26/2021	-	-	-	None	-	-	-
1047-01	Room 18	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1048-01	Art Room 21 by Door	SK	App	1.09	5/26/2021	-	-	-	None	-	-	-
1048-02	Art Room 21 by Window	SK	App	2.31	5/26/2021	-	-	-	None	-	-	-
1049-01	Faculty Bathroom 22A by Room 22	SK	App	1.55	5/26/2021	-	-	-	None	-	-	-
1050-01	Science Room 22 Counter	SK	App	25	5/26/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1050-02	Science Room 22 Pod 1 @ A	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-03	Science Room 22 Pod 1 @ B	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-04	Science Room 22 Pod 2 @ A	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-05	Science Room 22 Pod 2 @ B	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-06	Science Room 22 Pod 3 @ A	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-07	Science Room 22 Pod 3 @ B	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-08	Science Room 22 Pod 4 @ A	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-
1050-09	Science Room 22 Pod 4 @ B	SK	N/A		5/26/2021	-	-	-	None	SIGN	-	-

Laboratory Report

NYE Report #: 2212422-18004

May 28, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: James Vernon Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 26, 2021. New York Environmental analyzed the samples on May 27, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

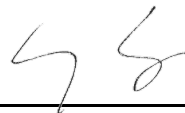

Li Tsang, Laboratory Director

Date Collected:	26 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210527I001	1	Kitchen 3-Bay Left-SK; Initial	1.00	<1.00	µg/L	
210527I002	2	Kitchen 3-Bay Right-SK; Initial	1.00	<1.00	µg/L	
210527I003	3	Nurse's Office-SK; Initial	1.00	3.98	µg/L	
210527I004	4	Faculty Bathroom 50 by Principal's Office-SK; Initial	1.00	<1.00	µg/L	
210527I005	5	Faculty Bathroom 48 by Principal's Office-SK; Initial	1.00	<1.00	µg/L	
210527I006	6	Boy's Bathroom 41 by Library Left-SK; Initial	1.00	<1.00	µg/L	
210527I007	7	Boy's Bathroom 41 by Library Left Middle-SK; Initial	1.00	<1.00	µg/L	
210527I008	8	Boy's Bathroom 41 by Library Right Middle-SK; Initial	1.00	1.27	µg/L	
210527I009	9	Boy's Bathroom 41 by Library Right-SK; Initial	1.00	1.02	µg/L	
210527I010	10	Hall by Library-BF; Initial	1.00	<1.00	µg/L	
210527I011	11	Hall by Library-WF; Initial	1.00	<1.00	µg/L	
210527I012	12	Girl's Bathroom 43 by Library Left-SK; Initial	1.00	<1.00	µg/L	
210527I013	13	Girl's Bathroom 43 by Library Middle-SK; Initial	1.00	1.12	µg/L	
210527I014	14	Girl's Bathroom 43 by Library Right-SK; Initial	1.00	1.26	µg/L	
210527I015	15	Room 6-SK; Initial	1.00	3.34	µg/L	
210527I016	16	Room 6-WF; Initial	1.00	<1.00	µg/L	
210527I017	17	Room 5-SK; Initial	1.00	5.17	µg/L	
210527I018	18	Room 5-WF; Initial	1.00	<1.00	µg/L	
210527I019	19	Room 4-SK; Initial	1.00	11.0	µg/L	
210527I020	20	Room 4-WF; Initial	1.00	<1.00	µg/L	
210527I021	21	Room 3-SK; Initial	1.00	5.10	µg/L	
210527I022	22	Room 3-WF; Initial	1.00	1.02	µg/L	
210527I023	23	Room 2-SK; Initial	1.00	5.31	µg/L	
210527I024	24	Room 2-WF; Initial	1.00	<1.00	µg/L	
210527I025	25	Room 1-SK; Initial	1.00	2.34	µg/L	
210527I026	26	Room 1-WF; Initial	1.00	<1.00	µg/L	



Date Collected:	26 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
2105271027	27	Head Custodian's Office 38-SK; Initial	1.00	3.91	µg/L	
2105271028	28	Coach's Office 37-SK; Initial	1.00	2.27	µg/L	
2105271029	29	Boy's Locker Room Bathroom 36-SK; Initial	1.00	1.28	µg/L	
2105271030	30	Hall by Boy's Locker Room 36-WF; Initial	1.00	4.58	µg/L	
2105271031	31	Girl's Locker Room Bathroom 35-SK; Initial	1.00	3.36	µg/L	
2105271032	32	Faculty Room 72-SK; Initial	1.00	<1.00	µg/L	
2105271033	33	Boy's Bathroom 62 by Room 63 Left-SK; Initial	1.00	<1.00	µg/L	
2105271034	34	Boy's Bathroom 62 by Room 63 Middle-SK; Initial	1.00	<1.00	µg/L	
2105271035	35	Boy's Bathroom 62 by Room 63 Right-SK; Initial	1.00	<1.00	µg/L	
2105271036	36	Girl's Bathroom 60 by Room 63 Left-SK; Initial	1.00	<1.00	µg/L	
2105271037	37	Girl's Bathroom 60 by Room 63 Middle-SK; Initial	1.00	<1.00	µg/L	
2105271038	38	Girl's Bathroom 60 by Room 63 Right-SK; Initial	1.00	1.11	µg/L	
2105271039	39	Hall by Room 63 Left-WF; Initial	1.00	<1.00	µg/L	
2105271040	40	Hall by Room 63 Middle-WF; Initial	1.00	<1.00	µg/L	
2105271041	41	Hall by Room 63 Middle-BF; Initial	1.00	<1.00	µg/L	
2105271042	42	Hall by Room 63 Right-WF; Initial	1.00	<1.00	µg/L	
2105271043	43	Faculty Bathroom 70 by Room 68B-SK; Initial	1.00	<1.00	µg/L	
2105271044	44	Faculty Bathroom 71 by Room 68B-SK; Initial	1.00	<1.00	µg/L	
2105271045	45	Room 33A-SK; Initial	1.00	8.25	µg/L	
2105271046	46	Room 32-SK; Initial	1.00	4.96	µg/L	
2105271047	47	Room 32 / 31 Prep Room-SK; Initial	1.00	66.9	µg/L	E,H
2105271048	48	Room 31 Left-SK; Initial	1.00	4.88	µg/L	
2105271049	49	Room 31 Middle-SK; Initial	1.00	4.28	µg/L	
2105271050	50	Room 31 Right-SK; Initial	1.00	6.80	µg/L	
2105271051	51	Room 30-SK; Initial	1.00	7.79	µg/L	
2105271052	52	Faculty Bathroom 30B by Room 26-SK; Initial	1.00	<1.00	µg/L	
2105271053	53	Faculty Bathroom 30A by Room 26-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	26 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
2105271054	54	Hall by Room 27 Portable-SK; Initial	1.00	2.40	µg/L	
2105271055	55	Room 11-SK; Initial	1.00	3.30	µg/L	
2105271056	56	Room 13-SK; Initial	1.00	<1.00	µg/L	
2105271057	57	Boy's Bathroom by Room 13 Left-SK; Initial	1.00	<1.00	µg/L	
2105271058	58	Boy's Bathroom by Room 13 Right-SK; Initial	1.00	<1.00	µg/L	
2105271059	59	Hall by Room 13-WF; Initial	1.00	<1.00	µg/L	
2105271060	60	Hall by Room 13-BF; Initial	1.00	<1.00	µg/L	
2105271061	61	Girl's Bathroom by Room 13 Left-SK; Initial	1.00	<1.00	µg/L	
2105271062	62	Girl's Bathroom by Room 13 Right-SK; Initial	1.00	<1.00	µg/L	
2105271063	63	Room 15-SK; Initial	1.00	<1.00	µg/L	
2105271064	64	Room 14-SK; Initial	1.00	<1.00	µg/L	
2105271065	65	Room 17-SK; Initial	1.00	<1.00	µg/L	
2105271066	66	Room 16-SK; Initial	1.00	3.76	µg/L	
2105271067	67	Room 20 BR-SK; Initial	1.00	4.48	µg/L	
2105271068	68	Room 18-SK; Initial	1.00	<1.00	µg/L	
2105271069	69	Art Room 21 by Door-SK; Initial	1.00	1.09	µg/L	
2105271070	70	Art Room 21 by Window-SK; Initial	1.00	2.31	µg/L	
2105271071	71	Faculty Bathroom 22A by Room 22-SK; Initial	1.00	1.55	µg/L	
2105271072	72	Science Room 22 Counter-SK; Initial	1.00	25.0	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Island	SK	App	8.43	5/26/2021	-	-	-	None	-	-	-
1001-2	Kitchen pot filler	PF	App	282	5/26/2021				Additional Sampling Required			
1001-3	Kitchen 3 Bay left	SK	App	10.6	5/26/2021	-	-	-	None	-	-	-
1001-4	Kitchen 3 Bay right	SK	App	5.94	5/26/2021	-	-	-	None	-	-	-
1001-5	Kitchen ice machine	IM	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1001-6	Kitchen sink by ice machine	SK	App	38.4	5/26/2021				Additional Sampling Required			
1001-7	Kitchen Staff Bathroom	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1001-8	Kitchen Hall Slop Sink	SS	N/A		5/26/2021	-	-	-	Sign Required	-	-	-
1002-1	Hall by Room 22	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1002-2	Hall by Room 22	BF	App	1.53	5/26/2021	-	-	-	None	-	-	-
1003-1	Room 22	SK	App	1.42	5/26/2021	-	-	-	None	-	-	-
1003-2	Room 22	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1004-1	Room 23	SK	App	1.29	5/26/2021	-	-	-	None	-	-	-
1004-2	Room 23	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1005-1	Room 24	SK	App	1.33	5/26/2021	-	-	-	None	-	-	-
1005-2	Room 24	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1006-1	Room 25	SK	App	1.61	5/26/2021	-	-	-	None	-	-	-
1006-2	Room 25	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1007-1	Room 26	SK	App	5.17	5/26/2021	-	-	-	None	-	-	-
1007-2	Room 26	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-1	Room 27	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1008-2	Room 27	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1009-1	Room 44	SS	App		5/26/2021	-	-	-	Sign Required	-	-	-
1010-1	PF Office	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-1	Hall by PE Office	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1011-2	Hall by PE Office	BF	App	1.32	5/26/2021	-	-	-	None	-	-	-
1012-1	Boy's Bathroom by PE Office	SK	App	2.8	5/26/2021	-	-	-	None	-	-	-
1013-1	Girl's Bathroom by PE Office	SK	App	5.05	5/26/2021	-	-	-	None	-	-	-
1014-1	Men's Bathroom by Music Room	SK	App	2.01	5/26/2021	-	-	-	None	-	-	-
1015-1	CC by Music Room	SS	N/A		5/26/2021	-	-	-	None	Locked Door	-	-
1016-1	Women's Bathroom by Music Room	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1017-1	Faculty Room	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1018-1	Room 16A Bathroom	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1019-1	Music Room	SK	App	18.9	5/26/2021				Additional Sampling Required			
1020-1	Principal's Office Bathroom	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1021-1	Hall by Main office	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1021-2	Hall by Main office	BF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
1022-1	Custodial Closet 39	SS	N/A		5/26/2021	-	-	-	None	Locked Door	-	-
1023-1	Nurse's Office	SK	App		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1024-1	Hall by Nurse	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-1	Room 4	SK	App	1.36	5/26/2021	-	-	-	None	-	-	-
1026-1	Staff BR by Nurse's	SK	App	3.74	5/26/2021	-	-	-	None	-	-	-
1027-1	Room 3	SK	App	12.7	5/26/2021	-	-	-	None	-	-	-
1027-2	Room 3	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1028-1	Room 5	SK	App	3.99	5/26/2021	-	-	-	None	-	-	-
1028-2	Room 5	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
1029-1	Room 6	SK	App	1.98	5/26/2021	-	-	-	None	-	-	-
1030-1	Room 7	SK	App	4.64	5/26/2021	-	-	-	None	-	-	-
1031-1	Room 8	SK	App	5.66	5/26/2021	-	-	-	None	-	-	-
1031-2	Room 8	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2001-1	Second Floor Hall	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2001-2	Second Floor Hall	BF	App	<1.0	5/26/2021	-	-	-	None	-	-	-
2002-1	Room 9	SK	App	1.58	5/26/2021	-	-	-	None	-	-	-
2002-2	Room 9	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2003-1	Girl's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-2	Girl's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-3	Girl's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-4	Girl's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-1	Boy's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-2	Boy's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-3	Boy's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2004-4	Boy's Bathroom on 2nd Floor	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2005-1	Room 10 - left	SK	App	4.06	5/26/2021	-	-	-	None	-	-	-
2005-2	Room 10 - right	SK	App	15.5	5/26/2021				Additional Sampling Required			
2006-1	Room 11	SK	App	<1.0	5/26/2021	-	-	-	None	-	-	-
2006-2	Room 11	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2006-3	Room 11 Bathroom	SK	N/A		5/26/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2007-1	Room 13	SK	App	6.26	5/26/2021	-	-	-	None	-	-	-
2007-2	Room 13	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2008-1	Room 12	SK	App	4.31	5/26/2021	-	-	-	None	-	-	-
2008-2	Room 12	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2009-1	Room 14	SK	App	4.18	5/26/2021	-	-	-	None	-	-	-
2009-2	Room 14	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-
2010-1	Room 15	SK	App	3.7	5/26/2021	-	-	-	None	-	-	-
2010-2	Room 15	WF	App		5/26/2021	-	-	-	None	Removed from service	-	-

Laboratory Report

NYE Report #: 2212423-18005

June 1, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Theodore Roosevelt Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 26, 2021. New York Environmental analyzed the samples on May 27, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

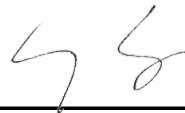

Li Tsang, Laboratory Director

Date Collected:	26 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
2105271073	1	Kitchen Island-SK; Initial	1.00	8.43	µg/L	
2105271074	2	Kitchen pot filler-PF; Initial	1.00	282	µg/L	E,H
2105271075	3	Kitchen 3 Bay left-SK; Initial	1.00	10.6	µg/L	
2105271076	4	Kitchen 3 Bay right-SK; Initial	1.00	5.94	µg/L	
2105271077	5	Kitchen ice machine-IM; Initial	1.00	<1.00	µg/L	
2105271078	6	Kitchen sink by ice machine-SK; Initial	1.00	38.4	µg/L	H
2105271079	7	Hall by Room 22-BF; Initial	1.00	1.53	µg/L	
2105271080	8	Room 22-SK; Initial	1.00	1.42	µg/L	
2105271081	9	Room 23-SK; Initial	1.00	1.29	µg/L	
2105271082	10	Room 24-SK; Initial	1.00	1.33	µg/L	
2105271083	11	Room 25-SK; Initial	1.00	1.61	µg/L	
2105271084	12	Room 26-SK; Initial	1.00	5.17	µg/L	
2105271085	13	Room 27-SK; Initial	1.00	<1.00	µg/L	
2105271086	14	Hall by PE Office-BF; Initial	1.00	1.32	µg/L	
2105271087	15	Boy's Bathroom by PE Office-SK; Initial	1.00	2.80	µg/L	
2105271088	16	Girl's Bathroom by PE Office-SK; Initial	1.00	5.05	µg/L	
2105271089	17	Men's Bathroom by Music Room-SK; Initial	1.00	2.01	µg/L	
2105271090	18	Faculty Room-SK; Initial	1.00	<1.00	µg/L	
2105271091	19	Music Room-SK; Initial	1.00	18.9	µg/L	H
2105271092	20	Hall by Main office-BF; Initial	1.00	<1.00	µg/L	
2105271093	21	Room 4 -SK; Initial	1.00	1.36	µg/L	
2105271094	22	Staff BR by Nurse's-SK; Initial	1.00	3.74	µg/L	
2105271095	23	Room 3-SK; Initial	1.00	12.7	µg/L	
2105271096	24	Room 5-SK; Initial	1.00	3.99	µg/L	
2105271097	25	Room 6-SK; Initial	1.00	1.98	µg/L	
2105271098	26	Room 7-SK; Initial	1.00	4.64	µg/L	



Date Collected:	26 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
2105271099	27	Room 8-SK; Initial	1.00	5.66	µg/L	
2105271100	28	Second Floor Hall-BF; Initial	1.00	<1.00	µg/L	
2105271101	29	Room 9-SK; Initial	1.00	1.58	µg/L	
2105271102	30	Room 10 - left-SK; Initial	1.00	4.06	µg/L	
2105271103	31	Room 10 - right-SK; Initial	1.00	15.5	µg/L	H
2105271104	32	Room 11-SK; Initial	1.00	<1.00	µg/L	
2105271105	33	Room 13-SK; Initial	1.00	6.26	µg/L	
2105271106	34	Room 12-SK; Initial	1.00	4.31	µg/L	
2105271107	35	Room 14-SK; Initial	1.00	4.18	µg/L	
2105271108	36	Room 15-SK; Initial	1.00	3.70	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-01	Kitchen Bathroom	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1001-02	Kitchen Handwash	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1001-03	Kitchen 3-Bay Left	SK	App	1.24	5/24/2021	-	-	-	None	-	-	-
1001-04	Kitchen 3-Bay Right	SK	App	1.42	5/24/2021	-	-	-	None	-	-	-
1002-01	Cafeteria	WF	App		5/24/2021	-	-	-	None	Removed from Service	-	-
1002-02	Cafeteria	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1003-01	Room 116B Bathroom	SK	App	4.8	5/24/2021	-	-	-	None	-	-	-
1004-01	Hall by Room 116	WF	App	25.3	5/24/2021				Additional Sampling Required			
1005-01	Boy's Bathroom 114B Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-02	Boy's Bathroom 114B Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1006-01	Faculty Room	SK	App	3.91	5/24/2021	-	-	-	None	-	-	-
1007-01	Hall by Room 111	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1007-02	Hall by Room 111	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1008-02	Nurse's Office Bathroom	SK	App	11.5	5/24/2021	-	-	-	None	-	-	-
1008-01	Nurse's Office	SK	App	13	5/24/2021	-	-	-	None	-	-	-
1009-01	Boy's Bathroom 106A Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1009-02	Boy's Bathroom 106A Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1010-01	Hall by Room 105	WF	App	6.59	5/24/2021	-	-	-	None	-	-	-
1011-01	Women's Faculty Bathroom by Room 104 Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1011-02	Women's Faculty Bathroom by Room 104 Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-01	Room 103	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1013-01	Hall by Band Room 18 Left	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1013-02	Hall by Band Room 18 Right	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1013-03	Hall by Band Room 18 Right	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1014-01	Art Room 17 Counter	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1014-02	Art Room 17 Trough Left	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1014-03	Art Room 17 Trough Middle	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1014-04	Art Room 17 Trough Right	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1015-01	Band Room 18	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1016-01	Faculty Bathroom by Band Room 18	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1017-01	Custodial Closet 13 by Band Room 18	SS	N/A		5/24/2021	-	-	-	None	Locked Door	-	-
1018-01	Photography Room 102	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1019-01	Art Room 101 Trough Left	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1019-02	Art Room 101 Trough Middle	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1019-03	Art Room 101 Trough Right	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1020-01	Girl's Locker Room B athroom Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1020-02	Girl's Locker Room Bathroom Unit @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1020-03	Girl's Locker Room Bathroom Unit @ C	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1021-01	Boy's Locker Room B athroom Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1021-02	Boy's Locker Room Bathroom Unit @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-03	Boy's Locker Room Bathroom Unit @ C	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1022-02	Training Room Bathroom	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1022-01	Training Room	IM	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1023-01	Women's Faculty Bathroom by Room A8	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1024-01	Hall by Room A8 Left	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1024-02	Hall by Room A8 Right	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1025-01	Men's Faculty Bathroom by Room A9	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1026-01	Custodial Closet 2 by Room A9	SS	N/A		5/24/2021	-	-	-	None	Locked Door	-	-
1027-01	Boy's Team Room	WF	App	4.64	5/24/2021	-	-	-	None	-	-	-
1027-02	Boy's Team Room Bathroom Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1027-03	Boy's Team Room Bathroom Unit @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1028-01	Girl's Team Room Locker Room	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1028-02	Girl's Team Room Locker Room Bathroom @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1028-03	Girl's Team Room Locker Room Bathroom @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1029-01	Concession Stand A13	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1030-01	Women's Faculty Bathroom by Room GS1 Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1030-02	Women's Faculty Bathroom by Room GS1 Unit @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1030-03	Women's Faculty Bathroom by Room GS1 Unit @ C	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1031-01	Hall by Room GS1 Left	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1031-02	Hall by Room GS1 Right	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-03	Hall by Room GS1 Right	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1032-01	Custodial Closet 1 by Room GS1	SS	N/A		5/24/2021	-	-	-	None	Locked Door	-	-
1033-01	Men's Faculty Bathroom by Room GS1 Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1033-02	Men's Faculty Bathroom by Room GS1 Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1033-03	Men's Faculty Bathroom by Room GS1 Unit @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1034-01	Library Bathroom	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1034-02	Library Special Services Office	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1034-03	Library Room L4 Kitchenette	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1035-01	Home Economics Room 117 Station 1	SK	App	<1.0	5/24/2021	-	-	-	None	-	-	-
1035-02	Home Economics Room 117 Station 2	SK	App	1.19	5/24/2021	-	-	-	None	-	-	-
1035-03	Home Economics Room 117 Station 3	SK	App	1.39	5/24/2021	-	-	-	None	-	-	-
1035-04	Home Economics Room 117 Station 4	SK	App	1.06	5/24/2021	-	-	-	None	-	-	-
1036-01	Tech Room 118A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-01	Science Room 119 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-02	Science Room 119 Pod 1 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-03	Science Room 119 Pod 1 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-04	Science Room 119 Pod 2 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-05	Science Room 119 Pod 2 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-06	Science Room 119 Pod 3 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-07	Science Room 119 Pod 3 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-08	Science Room 119 Pod 4 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-09	Science Room 119 Pod 4 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-10	Science Room 119 Pod 5 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-11	Science Room 119 Pod 5 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-12	Science Room 119 Pod 6 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-13	Science Room 119 Pod 6 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1037-14	Science Room 119 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
1038-01	Courtyard Greenhouse	SP	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
1038-02	Courtyard Greenhouse	SS	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
2001-01	Hall by Room 206	WF	App	1.97	5/24/2021	-	-	-	None	-	-	-
2002-01	Room 212A Bathroom	SK	App	6.21	5/24/2021	-	-	-	None	-	-	-
2003-01	Hall by Room 212A	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
2003-02	Hall by Room 212A	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
2004-01	Science Room 216 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2004-02	Science Room 216 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2010-01	Hall by Room 216	WF	App	22.3	5/24/2021				Additional Sampling Required			
2011-01	Women's Faculty Bathroom by Room 216 Left	SK	App	5.11	5/24/2021	-	-	-	None	-	-	-
2011-02	Women's Faculty Bathroom by Room 216 Right	SK	App	5.39	5/24/2021	-	-	-	None	-	-	-
2005-01	Science Room 217 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-02	Science Room 217 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2005-03	Science Room 217 Pod 1 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-04	Science Room 217 Pod 1 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-05	Science Room 217 Pod 2 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-06	Science Room 217 Pod 2 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-07	Science Room 217 Pod 3 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-08	Science Room 217 Pod 3 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-09	Science Room 217 Pod 4 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-10	Science Room 217 Pod 4 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-11	Science Room 217 Pod 5 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-12	Science Room 217 Pod 5 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-13	Science Room 217 Pod 6 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-14	Science Room 217 Pod 6 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2005-15	Science Room 217 / 219 Prep Room	SK	App	44.6	5/24/2021				Additional Sampling Required			
2006-01	Hall by Room 217	WF	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2007-01	Tech Room 219	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-01	Science Room 220 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-02	Science Room 220 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-03	Science Room 220 Pod 1 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-04	Science Room 220 Pod 1 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-05	Science Room 220 Pod 2 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-06	Science Room 220 Pod 2 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-07	Science Room 220 Pod 3 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-08	Science Room 220 Pod 3 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-09	Science Room 220 Pod 4 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-10	Science Room 220 Pod 4 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-11	Science Room 220 Pod 5 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-12	Science Room 220 Pod 5 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-13	Science Room 220 Pod 6 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-14	Science Room 220 Pod 6 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2008-15	Science Room 220 Prep Room	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2009-01	Science 218 Counter @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2009-02	Science 218 Counter @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2012-01	Room 214B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2013-01	Boy's Bathroom 213A Custodial Closet	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2013-02	Boy's Bathroom 213A - left	SK	App	16.5	5/24/2021				Additional Sampling Required			
2013-03	Boy's Bathroom 213A - right	SK	App	1.41	5/24/2021	-	-	-	None	-	-	-
2014-01	Room 213	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
2015-01	Girl's Bathroom 204A Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2015-02	Girl's Bathroom 204A Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2016-01	Room 203A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2017-02	Men's Faculty Bathroom 201A Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2017-03	Men's Faculty Bathroom 201A Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2017-01	Men's Faculty Bathroom 201A Custodial Closet	SS	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3001-01	Hall by Room 306	WF	App	2.75	5/24/2021	-	-	-	None	-	-	-
3002-01	Faculty Bathroom 312A Left	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3002-02	Faculty Bathroom 312A Right	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3003-01	Hall by Room 311	WF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
3003-02	Hall by Room 311	BF	App	<1.0	5/24/2021	-	-	-	None	-	-	-
3004-01	Hall by Room 316	WF	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-01	Science Room 316 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-02	Science Room 316 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-03	Science Room 316 Fume Hood	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-04	Science Room 316 Pod 1 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-05	Science Room 316 Pod 1 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-06	Science Room 316 Pod 2 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-07	Science Room 316 Pod 2 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-08	Science Room 316 Pod 3 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-09	Science Room 316 Pod 3 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-10	Science Room 316 Pod 4 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-11	Science Room 316 Pod 4 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3005-12	Science Room 316 Pod 5 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-13	Science Room 316 Pod 5 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-14	Science Room 316 Pod 6 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-15	Science Room 316 Pod 6 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3005-16	Science Room 316 / 315 Prep Room	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-01	Science Room 315 Teacher's Station	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-02	Science Room 315 Counter	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-03	Science Room 315 Fume Hood	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-04	Science Room 315 Pod 1 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-05	Science Room 315 Pod 1 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-06	Science Room 315 Pod 2 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-07	Science Room 315 Pod 2 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-08	Science Room 315 Pod 3 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-09	Science Room 315 Pod 3 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-10	Science Room 315 Pod 4 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-11	Science Room 315 Pod 4 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-12	Science Room 315 Pod 5 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-13	Science Room 315 Pod 5 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-14	Science Room 315 Pod 6 @ A	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3006-15	Science Room 315 Pod 6 @ B	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3007-01	Boy's Bathroom 313A Custodial Closet	SS	N/A		5/24/2021	-	-	-	None	SIGN	-	-
3007-02	Boy's Bathroom 313A Left	SK	App	4.71	5/24/2021	-	-	-	None	-	-	-
3007-03	Boy's Bathroom 313A Right	SK	App	4.82	5/24/2021	-	-	-	None	-	-	-
3008-01	Science Room Teacher's Station	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3008-02	Science Room 311 Counter @ A	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3008-03	Science Room 311 Counter @ B	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3008-04	Science Room 311 Counter @ C	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3008-05	Science Room 311 Fume Hood	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3008-06	Science Room 311 Counter @ D	SK	N/A		5/24/2021	-	-	-	Sign Required	-	-	-
3009-01	Girl's Bathroom 304A Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3009-02	Girl's Bathroom 304A Right	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3010-01	Room 303A Bathroom	SK	App	6.31	5/24/2021	-	-	-	None	-	-	-
3011-01	Men's Faculty Bathroom 301A Custodial Closet	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3011-02	Men's Faculty Bathroom 301A Left	SK	N/A		5/24/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3011-03	Men's Faculty Bathroom 301A Right	SK	N/A		5/24/2021	-	-	-	None	SIGN	-	-
4001-01	Room 402 Left	SK	App	5.38	5/24/2021	-	-	-	None	-	-	-
4001-02	Room 402 Right	SK	App	5.35	5/24/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212424-18006

May 28, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Oyster Bay-east Norwich High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on May 26, 2021. New York Environmental analyzed the samples on May 27, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

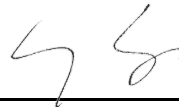

Li Tsang, Laboratory Director

Date Collected:	25 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210527J001	1	Kitchen 3-Bay Left-SK; Initial	1.00	1.24	µg/L	
210527J002	2	Kitchen 3-Bay Right-SK; Initial	1.00	1.42	µg/L	
210527J003	3	Cafeteria-WF; Initial	1.00	<1.00	µg/L	
210527J004	4	RM 116B BR-SK; Initial	1.00	4.80	µg/L	
210527J005	5	Hall by RM 116-WF; Initial	1.00	25.3	µg/L	H
210527J006	6	Faculty RM-SK; Initial	1.00	3.91	µg/L	
210527J007	7	Hall by RM 111-WF; Initial	1.00	<1.00	µg/L	
210527J008	8	Hall by RM 111-BF; Initial	1.00	<1.00	µg/L	
210527J009	9	Nurse's Office BR-SK; Initial	1.00	11.5	µg/L	
210527J010	10	Nurse's Office-SK; Initial	1.00	13.0	µg/L	
210527J011	11	Hall by RM 105-WF; Initial	1.00	6.59	µg/L	
210527J012	12	RM 103-SK; Initial	1.00	<1.00	µg/L	
210527J013	13	Hall by Band RM 18 Left-WF; Initial	1.00	<1.00	µg/L	
210527J014	14	Hall by Band RM 18 Right-WF; Initial	1.00	<1.00	µg/L	
210527J015	15	Hall by Band RM 18 Right-BF; Initial	1.00	<1.00	µg/L	
210527J016	16	Band RM 18-SK; Initial	1.00	<1.00	µg/L	
210527J017	17	Photography RM 102-SK; Initial	1.00	<1.00	µg/L	
210527J018	18	Training RM BR-SK; Initial	1.00	<1.00	µg/L	
210527J019	19	Training RM-IM; Initial	1.00	<1.00	µg/L	
210527J020	20	Hall by RM A8 Left-WF; Initial	1.00	<1.00	µg/L	
210527J021	21	Hall by RM A8 Right-WF; Initial	1.00	<1.00	µg/L	
210527J022	22	Boy's Team RM -WF; Initial	1.00	4.64	µg/L	
210527J023	23	Girl's Team RM Locker RM-WF; Initial	1.00	<1.00	µg/L	
210527J024	24	Concession Stand A13-SK; Initial	1.00	<1.00	µg/L	
210527J025	25	Hall by RM GS1 Left-SK; Initial	1.00	<1.00	µg/L	
210527J026	26	Hall by RM GS1 Right-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	25 May 2021
Date Received:	26 May 2021
Date Analyzed:	27 May 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210527J027	27	Hall by RM GS1 Right-SK; Initial	1.00	<1.00	µg/L	
210527J028	28	Library Special Services Office-SK; Initial	1.00	<1.00	µg/L	
210527J029	29	Library RM L4 Kitchenette-SK; Initial	1.00	<1.00	µg/L	
210527J030	30	Home Economics RM 117 Station 1-SK; Initial	1.00	<1.00	µg/L	
210527J031	31	Home Economics RM 117 Station 2-SK; Initial	1.00	1.19	µg/L	
210527J032	32	Home Economics RM 117 Station 3-SK; Initial	1.00	1.39	µg/L	
210527J033	33	Home Economics RM 117 Station 4-SK; Initial	1.00	1.06	µg/L	
210527J034	34	Hall by RM 206-WF; Initial	1.00	1.97	µg/L	
210527J035	35	RM 212A BR-SK; Initial	1.00	6.21	µg/L	
210527J036	36	Hall by RM 212A-WF; Initial	1.00	<1.00	µg/L	
210527J037	37	Hall by RM 212A-BF; Initial	1.00	<1.00	µg/L	
210527J038	38	Hall by RM 216-WF; Initial	1.00	22.3	µg/L	H
210527J039	39	WFBR by RM 216 Left-SK; Initial	1.00	5.11	µg/L	
210527J040	40	WFBR by RM 216 Right-SK; Initial	1.00	5.39	µg/L	
210527J041	41	Science RM 217 / 219 Prep RM-SK; Initial	1.00	44.6	µg/L	H
210527J042	42	BBR 213A Left-SK; Initial	1.00	16.5	µg/L	H
210527J043	43	BBR 213A Right-SK; Initial	1.00	1.41	µg/L	
210527J044	44	Hall by RM 306-WF; Initial	1.00	2.75	µg/L	
210527J045	45	Hall by RM 311-WF; Initial	1.00	<1.00	µg/L	
210527J046	46	Hall by RM 311-BF; Initial	1.00	<1.00	µg/L	
210527J047	47	BBR 313A Left-SK; Initial	1.00	4.71	µg/L	
210527J048	48	BBR 313A Right-SK; Initial	1.00	4.82	µg/L	
210527J049	49	RM 402 Left-SK; Initial	1.00	5.38	µg/L	
210527J050	50	RM 402 Right-SK; Initial	1.00	5.35	µg/L	
210527J051	51	RM 303A BR-SK; Initial	1.00	6.31	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

